

H. Streifeneder
Glasfaser-Flugzeug-Service GmbH
Hofener Weg
D-72582 Grabenstetten

**Technical Note
No. 303-14**

Type Certificate No. 318

Subject: Ailerons

Effectivity: Sailplane model **Mosquito**
All serial numbers up to No.123

Urgency: None, subsequent conversion possible.

Reason: In case of e.g. repair exchangeability of ailerons.

Instructions: Ailerons according to drawing no. 303-54-15, page 2 are replaced by ailerons according to drawing no. 303-54-16.
In the flight- and operations manual, page 50, the data for acceptable mass and control surface moments of the ailerons must be changed (handwritten supplement):

*"Aileron: 3.1 kg +-10% (incl. mass balance)
 0.0715 kgm +-10% (incl. mass balance)"*

Mass balance must be attached to the aileron in the outer third of aileron span.

Material: Lead strips 1350mm x 9mm x 2mm

Weight: Weight reduction about 2.4 kg

Balance: Not affected

Remarks: The accomplishment of this technical note is to be done only by a licensed repair station and must be entered into the aircraft log book by a licensed inspector.

Grabenstetten, 09.01.95

LBA - approved

(H. Streifeneder)
.....

20.Nov.1989 (Frieß)
.....

The German original of this technical note has been approved by the Luftfahrtbundesamt.
The translation into English has been done by best knowledge and judgement.